

Higgins Diesel Truck Repair

3011 N Frontage Road
Billings, MT 59101

181

Invoice

Date	Invoice #
10/13/2019	824-09

Bill To
MARK MOE TRUCKING LLC 26775 MICKELSON DRIVE STARBUCK, MN 56381

P.O. No.	Terms	Project
	Due on receipt	

Quantity	Description	Rate	Amount
	2009 PETERBILT 389; VIN-9D788398; MIL-1081324- UNIT-09		
	DOT INSPECT TRUCK, LOOK OVER TRUCK AND MAKE ROAD READY TO GO.	69.00	69.00
	FULL SERVICE ON TRUCK, DRAIN ALL FLUIDS AND REFILL WITH NEW OIL, GREASE , ETC.	275.00	275.00
	DRAIN ENGINE OIL, DRAIN TRANS AND BOTH DIFFS. REPLACED ENGINE FILTERS, REMOVED AND REPLACED AIR FILTERS. GREASE SUSPENSION AND DRIVE LINE. FILL ENGINE WITH DELVAC OIL. FILL TRANS WITH 50WT SYNTHETIC OIL. FILL DIFFS WITH 75W90 SYNTHETIC OIL.		
2	AIR FILTER	104.19	208.38
1	FUEL FILTER	23.80	23.80
1	WATER FILTER	39.30	39.30
1	FUEL FILTER	25.35	25.35
1	OIL FILTER	53.75	53.75
12	DELVAC OIL	13.95	167.40
30	50 WT SYNTHETIC	5.25	157.50
70	75W90 SYNTHETIC OIL	5.25	367.50
1	COOLANT EXTENDED SERVICE	11.95	11.95
	REPLACE BRAKES AND DRUMS ON REAR DRIVE AXLE.	375.00	375.00
Thank you for your business.		Total	

Higgins Diesel Truck Repair

3011 N Frontage Road
 Billings, MT 59101

181

Invoice

Date	Invoice #
10/13/2019	824-09

Bill To
MARK MOE TRUCKING LLC 26775 MICKELSON DRIVE STARBUCK, MN 56381

P.O. No.	Terms	Project
	Due on receipt	

Quantity	Description	Rate	Amount
	REMOVED FENDERS FROM TRUCK, REMOVED TIRES AND WHEELS. REMOVED DRUMS. INSTALL NEW SHOES, DRUMS AND REINSTALL WHEELS AND TIRES. ADJUST BRAKES. REINSTALL FENDERS AND SECURE. REMOVED AND REPLACED WORN RIGHT REAR SPRING EYE FRAME BRACKET WHEN HAD FENDERS OFF. INSTALL NEW BOLTS AS NEEDED, FOUND USED BRACKET.		
2	DRIVE AXLE BRAKES	55.00	110.00
2	BRAKE DRUM	115.00	230.00
1	USED SUSPENSION BRACKET	245.00	245.00
1	MISC BOLTS, WASHERS AND NUTS	25.00	25.00
	REPLACE BROKEN WINDSHIELDS.	250.00	250.00
	REMOVED DROP VISOR, REMOVED WINDSHIELDS, CLEAN UP HOUSINGS, INSTALL NEW GLASS. REINSTALL VISOR AND WASH WINDOWS. INSTALL NEW WIPER BLADES		
2	WINDSHIELD 389	79.50	159.00
1	SEALER	6.19	6.19
2	WIPER BLADES	10.19	20.38
	REPLACE WORN REAR ENGINE MOUNTS AS NEEDED.	325.00	325.00
	REMOVED BOLTS FROM BOTH SIDES ON REAR OF ENGINE, JACK UP ENGINE AND REMOVED BOLTS, INSTALL NEW BUSHINGS, WASHERS ETC. LET ENGINE DOWN AND TIGHTEN UP BOLTS.		
4	WASHER	12.35	49.40
1	BOLTS, NUTS ETC.	25.80	25.80
Thank you for your business.		Total	

Higgins Diesel Truck Repair

181

Invoice

3011 N Frontage Road
 Billings, MT 59101

Date	Invoice #
10/13/2019	824-09

Bill To
MARK MOE TRUCKING LLC 26775 MICKELSON DRIVE STARBUCK, MN 56381

P.O. No.	Terms	Project
	Due on receipt	

Quantity	Description	Rate	Amount
4	ENGINE BUSHINGS	30.62	122.48
	CLUTCH FAN IS LEAKING AIR, REPLACE AS NEEDED. CHECK TENSIONERS, BELTS ETC.	650.00	650.00
	LOOSEN UP RADIATOR, SHROUD, ETC. REMOVED FAN AND SHROUD, REMOVED BELTS, REMOVED FAN HUB, SWAP OVER FITTINGS, INSTALL NEW HUB AND TIGHTEN, IDLER FOR AC BELT AND TENSIONERS ARE BOTH BAD, BOTH BELTS ARE BAD, ROCKS STUCK ALTERNATOR, REPLACED PARTS AS NEEDED. REASSEMBLE AS NEEDED.		
1	CLUTCH FAN	922.70	922.70
1	BELT	103.66	103.66
1	BELT	47.75	47.75
1	TENSIONER	295.15	295.15
1	IDLER	113.98	113.98
1	ALTERNATOR	236.40	236.40
1	FAN SWITCH OVERRIDE	57.69	57.69
	INSPECT FIFTH WHEEL AND ADJUST.	150.00	150.00
	INSPECT FIFTH WHEEL, JAWS ARE WORN OUT, BUSHINGS ARE BAD. PRICE OUT TO REBUILD AND OR REPLACE. REMOVED PLATE AND REPLACE MOUNT BUSHINGS, INSTALL NEW TOP PLATE, GREASE PLATE, CHECK ADJUSTMENT. OK.		
2	MOUNT BUSHINGS	30.25	60.50
1	HOLLAND TOP PLATE	1,350.00	1,350.00
	REAR SUSPENSION WILL NOT HOLD AIR.	325.00	325.00

Thank you for your business.

Total

Higgins Diesel Truck Repair

3011 N Frontage Road
 Billings, MT 59101

181

Invoice

Date	Invoice #
10/13/2019	824-09

Bill To
MARK MOE TRUCKING LLC 26775 MICKELSON DRIVE STARBUCK, MN 56381

P.O. No.	Terms	Project
	Due on receipt	

Quantity	Description	Rate	Amount
	INSPECT SUSPENSION, FOUND 2 AIR BAGS LEAKING, AND SEVERAL FITTINGS LEAKING ON TOP OF BAGS, REMOVED AND REPLACED AIR BAGS AND FITTINGS AS NEEDED. RECHECK, OK.		
2	LOW AIR LEAF AIR BAG	256.00	512.00
2	MOUNT STUDS	9.02	18.04
1	FITTINGS ETC.	134.05	134.05
	CHECK OVER LIGHTS ON FRONT BUMPER.	150.00	150.00
	REPAIRED WIRING AND REPLACED LIGHTS AS NEEDED ON FRONT BUMPER.		
1	BUMPER LIGHTS LED	22.50	22.50
1	REPAIR HARNESS	7.38	7.38
	BULK HEAD AT FIREWALL IS BROKEN WHERE AIR LINES AND POWER IS GOING THRU.	825.00	825.00
	REMOVED INSIDE PANELS, REMOVED STEERING COLUMN, REMOVED SHAFT TO STEERING GEAR, REMOVED ELECTRICAL AND AIR HOSES FROM FIREWALL. REMOVED ALL LINES FROM INSIDE OF FIREWALL. REMOVED BROKEN PIECES. INSTALL NEW BULKHEAD AT FIREWALL. INSTALL NEW BULKHEAD AND AIR MANIFOLD. REASSEMBLE FIREWALL AIR LINES AND ELECTRICAL. ON BOTH SIDE OF FIREWALL. REPLACE TILT CABLE IT WAS SEIZED. REINSTALL STEERING COLUMN WITH NEW BOLTS. IT HAD SPACERS BEHIND IT. REINSTALL KICK PANELS WITH NEW SCREWS AS NEEDED, HALF THE CREWS WERE MISSING. RECHECK ALL SYSTEMS, EVERYTHING IS WORKING.		

Thank you for your business.

Total

Higgins Diesel Truck Repair

3011 N Frontage Road
Billings, MT 59101

181

Invoice

Date	Invoice #
10/13/2019	824-09

Bill To
MARK MOE TRUCKING LLC 26775 MICKELSON DRIVE STARBUCK, MN 56381

P.O. No.	Terms	Project
	Due on receipt	

Quantity	Description	Rate	Amount
1	BULKHEAD FIREWALL	128.99	128.99
1	AIR MANIFOLD	271.52	271.52
1	FIREWALL COVER	26.11	26.11
1	CABLE KIT	77.11	77.11
1	SCREWS, BOLTS, ETC	36.59	36.59
	SHOP SUPPLIES	165.39	165.39

Thank you for your business.

Total \$10,029.69