




2011 TEREX TA300

Year	Serial Number	Stock Number
2011	A11001062	CE1062

Drive	Location
6WD	Equify TM - Mike Culverhouse 777 Main St. Fort Worth, Texas USA 76102

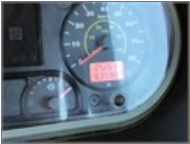

Category Specifics		
Dump Bed	Good	Normal Wear/ No Major Dents
Support Pad	Excellent	
Bed Liner	No	



General Appearance		
Guards/Covers/Steps	Good	Bent Bottom Step
Hood/Grill/Fenders	Good	Slightly Bent Fender
Glass/Mirrors	Good	Rear Screen/ Small Cracks In Windshield
Doors	Excellent	
Cab Condition	Excellent	
Cab Type	Enclosed	
Paint	Good	
Seat	Excellent	
Heater	Yes	
Steering Wheel Play	No	



Engine	
Engine Manufacturer	SCANIA
Engine Model	DC09 070A
Engine Serial Number	6676930
Blow-By	No
Oil Leaks?	No
Smokes	No
Turbocharger	Yes
Coolant Leaks	No
Coolant Levels	Good



Powertrain	
Transmission Type	AUTOMATIC
Forward Speed	2
Reverse Speed	2
Transmission Condition	Good
Torque Converter	Good
Linkage	Good
Final Drives	Good
Brakes	Good
Brake Type	HYDRAULIC
Emergency Brake works?	Yes
Pull Through Brakes?	No

Chassis	
Tire Brand	MAGNA
Tire Size	23.5 R25
Tire Type	MA02
Steering Linkage	Good
Articulating Center Pins	Good



Electrical

Batteries	Excellent	
Warning Lights Work	Yes	
Gauges Work	Yes	
Lights Work	Yes	Right Rear Tailight Inop



Hydraulics

Hoses	Good	
Cylinder Rods	Good	
Pumps	Good	Operational
Hydraulics Leak	Yes	Minor Various Leaks